


TOP VIEW

NO SCALE

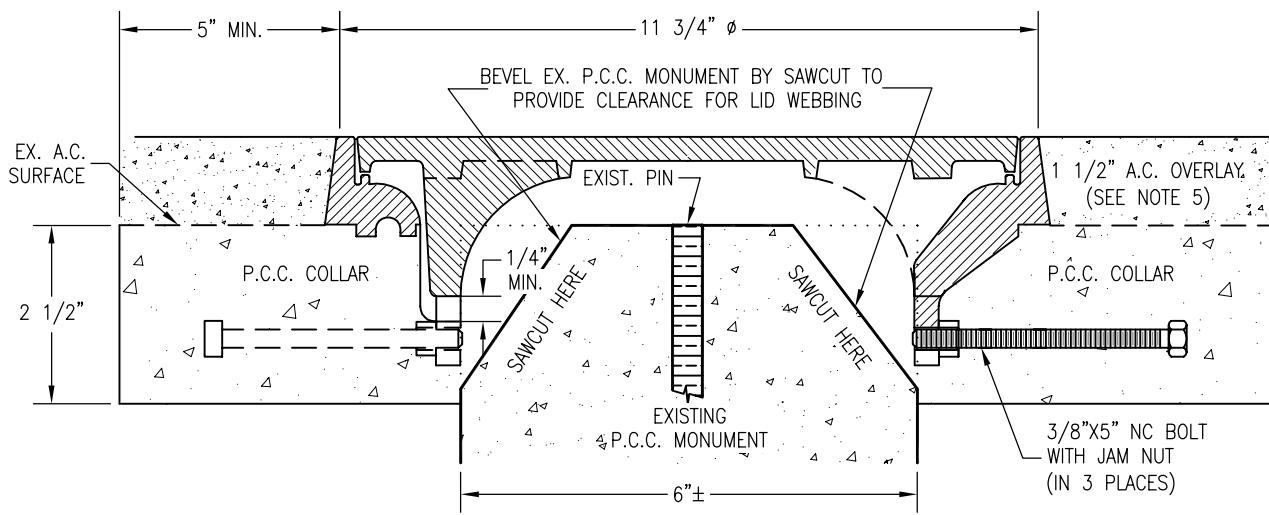

SECTION A-A

NO SCALE

NOTES:

1. WHERE AN EXISTING MONUMENT BOX CANNOT BE ADJUSTED TO GRADE WITH IRON EXTENSION RINGS, THE OLD BOX SHALL BE COMPLETELY REMOVED AND A NEW MONUMENT BOX INSTALLED. THIS ADJUSTMENT IS ALSO APPLICABLE TO MONUMENTS WHICH DO NOT HAVE MONUMENT BOXES.
2. MAINTAIN AT LEAST 1/4 INCH CLEARANCE BETWEEN LEGS OF THE NEW COVER AND THE CONCRETE COLLAR.
3. THE BEVELING OF THE EXISTING MONUMENT MUST BE SAW CUT. EXERCISE EXTREME CARE TO AVOID DAMAGE TO PIN.
4. ON STREETS WITH OVERLAY THICKNESS OF 2 1/2" OR 3", PROVIDE ADDITIONAL LOCKING GRADE RINGS COMBINED TO MATCH OVERLAY THICKNESS. ON STREETS WITH 2" OVERLAY, PROVIDE 2" GRADE RING. LOCKING GRADE RINGS AND COVER SHALL BE CHRISTY PRODUCTS FOR G5 TRAFFIC VALVE BOX OR APPROVED EQUAL (SEE DETAIL ST-14).
5. IF THE STABILITY OR LOCATION OF THE EXISTING MONUMENT IS AFFECTED BY THE SAWCUTTING, THE CONTRACTOR SHALL, AT HIS EXPENSE, FILE A CORNER RECORD WITH THE COUNTY SURVEYOR AND INSTALL A REPLACEMENT STANDARD MONUMENT.



DRAWN BY: M. LEE
CHECKED BY: B. TRAN
APPROVED BY: G. GOMEZ
DATE: DECEMBER 2002

SPECIAL MONUMENT BOX
ADJUSTMENT

ST-16

CITY OF SANTA CLARA

PAGE: 16